

WORK DESCRIPTION FOR FIELD MEASURE

Code: 21P8298702

Version: 2.0

Update map data of NTG7 head unit

Model 223 with code 534

i Code 534 corresponds to CONNECT 20 PREMIUM (NTG7).

Work procedure

1. Go to the start screen and open the settings in the head unit.
2. Tap on "Assistenz" 8 to 10 times.



Figure 1

3. Go to the "Navigation" tab and select the "delete mapdata" submenu.



Figure 2

4. Update map data for navigation system.

i For basic data, see **AR82.85-P-0100LWG**.

i The field "Request activation code" (**A, Figure 3**) must be active, otherwise the necessary authorizations are missing.

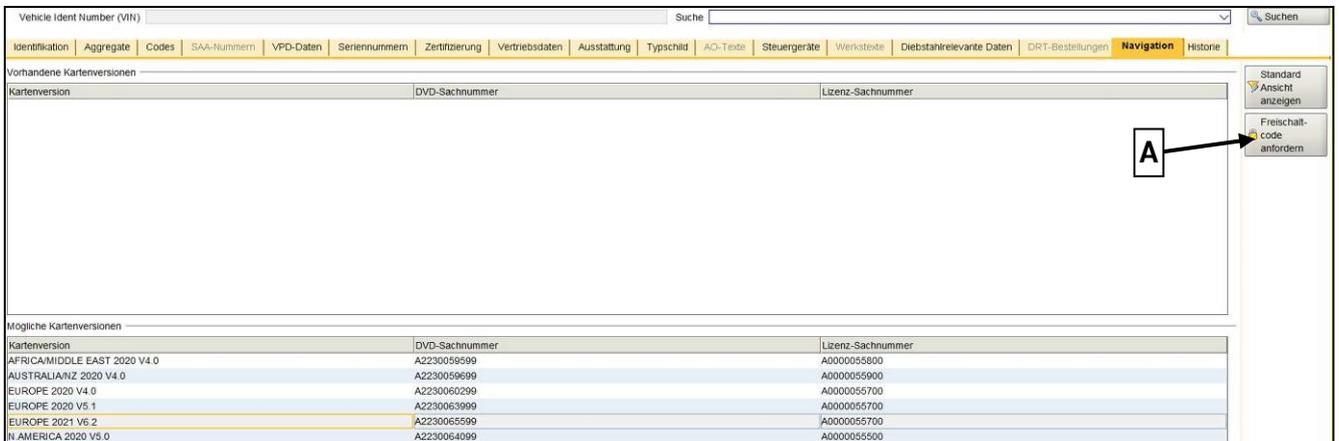


Figure 3

Operation text and flat rate

Operation no.	Operation text	Flat rate	Accounting no./ damage code
02-0921	Update map data of head unit Includes: Connect/disconnect starter battery charger	0.5 h	82 987 02

Mercedes-Benz
Global Service & Parts